



Tech Info Library

AppleShare Client for Windows & Intel Ethernet Pro Card (8/95)

Article Created: 7 August 1995

TOPIC -----

This article describes an installer Problem on PCs which have the Intel Ethernet Pro Card.

DISCUSSION -----

During the installation process, if the workstation has an Intel Ethernet Pro network interface card, the installer omits a necessary parameter for the AARP protocol. This necessary parameter is the network number. Manually edit the NET.CFG file and insert the 80F3 address as follows:

The affected line reads:

```
PROTOCOL AARP ETHERNET_SNAP
```

It should read:

```
PROTOCOL AARP 80F3 ETHERNET_SNAP
```

Support Information Services
Copyright 1995, Apple Computer, Inc.

Keywords: kwindows

=====

This information is from the Apple Technical Information Library.

19960215 11:05:19.00

Tech Info Library Article Number: 18309