



Tech Info Library

TokenTalk 2.0 Installer: Problem and Fix

This article last reviewed: 5 February 1990

TOPIC -----

This article discusses how to spot and fix incorrect TokenTalk 2.0 Installer disks.

DISCUSSION -----

I was installing some Macintosh IIs on a Token Ring network and discovered a problem with the TokenTalk 2.0 Installer disks that are shipping with the TokenTalk NB Card.

The TokenTalk 2.0 disk (Apple Part #690-5435-A) included with the cards is not configured properly for the System 6.0.4 Network Products Installer disk.

The released disk is named "Token Talk Installer" (there is a space between 'Token' and 'Talk') instead of "TokenTalk Installer", and this prevents the MultiDisk Installer from recognizing this disk. In addition, all of the files on the released disk are inside a folder called "TokenTalk Installer" (which should be the name of the disk). The proper files/folders are within this folder -- that is, Installer, Installer Scripts, and System Folder.

To recap: the hierarchy of the released disk:

```
Disk Name:           "Token Talk Installer"
1st Window contains: "TokenTalk Installer" folder
This folder contains: "Installer"
                    "Installer Scripts"
                    "System Folder"
```

Valid disks have this hierarchy:

```
Disk Name:           "TokenTalk Installer"
1st Window contains: "Installer"
                    "Installer Scripts"
                    "System Folder"
```

Renaming the released disk to the proper name (that is, removing the space) and then moving the Installer, Scripts, and System Folder to the main/root window makes this disk usable with the MultiDisk Installer.

(NOTE: As of February, 1990, Apple Manufacturing is aware of the mistake and has corrected it, so there shouldn't be many more of these disks sent out.)
Copyright 1990 Apple Computer, Inc.

Keywords: <None>

=====

This information is from the Apple Technical Information Library.

19960215 11:05:19.00

Tech Info Library Article Number: 5022