



# Tech Info Library

## ImageWriter II: New Logic Boards

This article last reviewed: 20 November 1987

### Problem:

After exchanging the the logic board in an ImageWriter II the error light comes on and the select light stays off. The printer does not respond to the computer or to a self test command.

### Cure:

All of the logic boards being shipped as exchange modules are the new Revision A boards. The Revision A boards are compatible with both the old mechanical paper out sensor and the new optical paper out sensor. Switch 3 on the logic board must be configured properly for the type of paper out sensor used on the printer. Jumper pins 1 and 2 for the mechanical sensor and pins 2 and 3 for the optical sensor. Refer to the ImageWriter II Technical Procedures for more information. Copyright 1988 Apple Computer, Inc.

Keywords: hts

=====  
This information is from the Apple Technical Information Library.

19960215 11:05:19.00

Tech Info Library Article Number: 1546