



Tech Info Library

ImageWriter PROBLEM/CURE: Prints Garbage After 1/4 Page

This article last reviewed: 28 April 1988

PROBLEM DESCRIPTION: ImageWriter prints OK during Self Test. When a Macintosh is used with certain software, the first several lines also print OK, but after about a quarter of a page is printed, the ImageWriter pauses, and then prints garbage.

CAUSE: The application may be using DTR handshaking flow control protocol (for more info search on HTS and FLOW CONTROL). If so, it needs pin 20 DTR from the IW to be connected to pin 7 on the Mac.

CURE: Check the cable for 5 pins. If it doesn't have 5 pins, chances are DTR from the IW is not connected to the Mac so the application doesn't know when the IW's print buffer has filled. If the cable doesn't have 5 pins, obtain cable P/N 590-0169. Also confirm that IW DIP switch SW2-3 is open to select DTR handshake. If problem still not found, search on ImageWriter General Troubleshooting.

Copyright 1988 Apple Computer, Inc.

Keywords: hts

=====
This information is from the Apple Technical Information Library.

19960215 11:05:19.00

Tech Info Library Article Number: 1382