

ImageWriter I: Blown Fuses on the Logic Board

This article last reviewed: 24 February 1988

PROBLEM DESCRIPTION: The printer doesn't power up, or the power light comes on but the carriage assembly doesn't move. Inspection of the logic board reveals that either one or more of the fuses is blown.

CAUSE: The small screw holding the screw which mounts the printer cable to the logic board may have dropped free and be shorting out pins.

CURE: 1. Carefully check the logic board and the inside of the printer for this small screw holder. Remove it.

- 2. Replace the fuses.
- 3. If the problem persists, refer to the Level I Technical Procdures.

If this cure does not resolve the problem, go back to the Word Search screen and search on the product's name and HTS and GTS to obtain a General Troubleshooting procedure.

Copyright 1988, Apple Computer, Inc.

This information is from the Apple Technical Information Library.

19960215 11:05:19.00

Keywords: hts

Tech Info Library Article Number: 1821