



# Tech Info Library

## LaserWriter IINT/IINTX: Symptoms of Badly Mounted Power Supply

Article Created: 15 April 1991

Article Last Reviewed:

Article Last Updated:

TOPIC -----

On power up, the LaserWriter IINT/NTX Ready light blinks, then the Toner light comes on solid. Shortly after this, both the Ready and Toner lights go solid, and the printer fails to generate a user self-test page. Subsequent service self-tests generate only blank pages.

DISCUSSION -----

These symptoms appear when the high-voltage power supply is incorrectly mounted with connector pins (to the DC Controller) completely missing their places. This only happens during a repair, when the high-voltage power supply is replaced.

Copyright 1991 Apple Computer, Inc.

Keywords: hts

=====  
This information is from the Apple Technical Information Library.

19960215 11:05:19.00

Tech Info Library Article Number: 7539