



Tech Info Library

PowerBook 500 Series: Floppy Drive Alignment Procedure (7/94)

Article Created: 12 July 1994

TOPIC -----

Why would a PowerBook 500 series machine have problem accepting floppy disks after the floppy drive was replaced?

DISCUSSION -----

The floppy drive in the PowerBook 500 must be aligned after being installed into the unit or it may not accept or eject diskettes properly.

To start the alignment process, start with the screw located closest to the display. With your free hand push from the rear of the drive towards the floppy disk insert slot located on the right hand side of the PowerBook.

While applying light pressure to the drive, tighten down the screw under the display then insert the remaining screws and tighten them down. The drive should be properly aligned in the PowerBook.

Support Information Services
Copyright 1994, Apple Computer, Inc

Keywords: kpbook

=====

This information is from the Apple Technical Information Library.

19960215 11:05:19.00

Tech Info Library Article Number: 15802