



Tech Info Library

PowerBook 100, 140, and 170: Fix Dates of Three Components

Article Created: 27 October 1992

TOPIC -----

How can I tell if my PowerBook has all of the known fixes installed already?

DISCUSSION -----

Below is a list of the manufacturing cut-in dates for the Inverter Shield, Display Cable Shim, and Revision B Floppy Disk Drive:

Inverter Shield:

F2150XXX 140's built in Fremont
CK205XXX 170's built in Cork

Display Shim:

F2208XXX 140's built in Fremont
FCXXXXXXX 140's built in Fountain
CK212XXX 140's built in Cork

Rev B Floppy Drive:

F2211XXX 140's 4/40 built in Fremont
F2212XXX 140's 4/80 built in Fremont
FC213XXX 140's built in Fountain
CK213XXX 140's built in Cork
CK213XXX 170's built in Cork

Notes:

- 1) If a PowerBook has been sent back to the Central Product Repair Center for repair, it may have one or all of these fixes already installed.
- 2) All PowerBook 100 external floppy drives were built before the Revision B floppy drive was available, so all external floppy drives are Revision A mechanisms unless they have been returned to the Central Product Repair Center or a dealer for repair.
- 3) The Display Cable Shim and the Inverter Shield haven't been identified as necessary on the PowerBook 100.

Support Information Services

Copyright 1992, Apple Computer, Inc.

Keywords: kpbook

=====

This information is from the Apple Technical Information Library.

19960215 11:05:19.00

Tech Info Library Article Number: 10569