



Tech Info Library

Color OneScanner 600/27: Freezes After First Scan (8/96)

Article Created: 12 August 1996

* RESTRICTED: Apple Internal and Support Providers Only *
Not For General Public Release

TOPIC -----

Why does the Color OneScanner 600/27 "freeze" after the first scan?

DISCUSSION -----

The cause of the successful first scan, but subsequent failure of the second scan is an optical unit misalignment. On first scan the scanner senses the edge of the black calibration strip within its specified 5 mm from home position so it scans properly. However, when the carriage returns to home position in the high speed drive mode, it slightly overshoots the home position. When it tries to find the edge of the black calibration strip this time, it cannot find it within 5 mm and "hangs", or "freezes". To correct this, replace the Optical Assembly (661-1084).

Copyright 1996, Apple Computer, Inc.

Keywords: <None>

=====

This information is from the Apple Technical Information Library.

19960813 07:31:10.00

Tech Info Library Article Number: 20277