



Tech Info Library

DOS Compatibility Card: Sizzling Speaker Sound (4/96)

Article Created: 2 October 1995

Article Reviewed/Updated: 17 April 1996

* RESTRICTED: Apple Internal and Support Providers Only *
Not For General Public Release

TOPIC -----

I have a Power Macintosh 6100 and Performa 640 DOS Compatible computer and on occasion I get a static or sizzling noise from my speakers. What is causing this?


DISCUSSION -----

The problem is most likely caused by the Sound Board on your DOS Compatibility Card. Apple has taken steps to resolve this issue by implementing a change to the Sound Board to prevent this noise from occurring.

If you have a Power Macintosh 6100 or Performa 640 DOS Compatible system that intermittently produces a static or sizzling noise from the speaker, replace the DOS Compatible Sound Board (p/n 661-0253).

If you are unsure whether or not the Sound Board that you have has been revised refer to the figure below:

Begin_Graphic

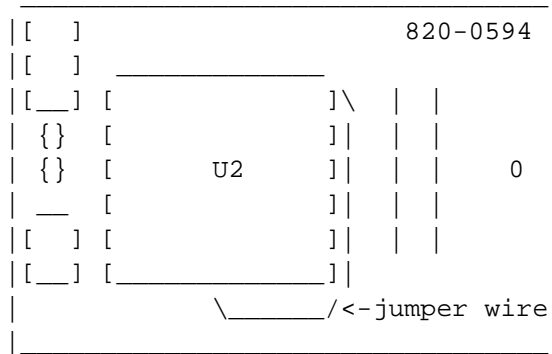

DOS Compatibility Sound Board

End_Graphic

NOTE:

If the sound board has been revised it has a jumper from pin-79 to pin-24 (PDN) of the chip at location U2. If the jumper is not present, the board has not been revised.

Article Change History:

17 Apr 1996 - Replaced entire discussion.

Copyright 1995, Apple Computer, Inc.

Keywords: hts,kwindows

=====

This information is from the Apple Technical Information Library.

19960417 17:15:44.00

Tech Info Library Article Number: 18676