Macintosh II: Disk Drive Appears Write-Protected (11/94)

Article Created: 14 March 1989 Article Reviewed/Updated: 07 November 1994
* RESTRICTED: Apple Internal and Support Providers Only * Not For General Public Release
TOPIC
Diskettes inserted into the internal floppy drive of my Macintosh II appear to be write-protected. If drive is replaced and the top cover reinstalled the sam symptom reappears.
DISCUSSION
Test the system without the top cover installed. If the drive tests properly check the grounding tabs on the RFI shield near the drive. One of them may be bent inward which pushes the write protect switch on the mechanical assembly down causing the failure. Bend the tab back to its proper position and reinstall the top cover.
Test the system with the top cover reinstalled to make sure the drive is functional.
Article Change History: 07 Nov 1994 - Reviewed for technical accuracy.
Support Information Services Copyright 1988-94 Apple Computer, Inc.
Keywords: hts
This information is from the Apple Technical Information Library

19960215 11:05:19.00 Tech Info Library Article Number: 3525