



Tech Info Library

SuperMac Video Cards: Macintosh Quadra 700/900 Compatibility

Article Created: 4 February 1992

* RESTRICTED: Apple Internal and Support Providers Only *
Not For General Public Release

TOPIC -----

There have been reports of some compatibility problems between the Macintosh Quadra series and several SuperMac Technology video cards.

SuperMac is telling customers that there is a battery problem and that the PRAM loses information for their video cards.

DISCUSSION -----

SuperMac Thunder/24 Cards -----

Revision G of the Thunder/24 card fixes the "no video at startup" problem. Thunder/24 cards require revision G or later with 1.161 ROMs for Macintosh Quadra compatibility.

Spectrum/24 PDQ+ Cards -----

Spectrum/24 PDQ+ cards should be revision A3 or later with 1.191 ROMs to ensure Macintosh Quadra compatibility.

Spectrum 8•24 PDQ Cards -----

Spectrum 8•24 PDQ cards require a ROM upgrade to fix a marginally serious problem (encountered only with the RasterOps timing settings). This ROM upgrade will be available mid- to end-February 1992.

Thunder/8 Cards -----

Thunder/8 cards require a hardware revision. These are being handled as special cases.

For more details:

- Authorized dealers should contact SuperMac's Technical Support.
- Developers should contact Tim Gray at SuperMac.
- Customers should contact their authorized SuperMac dealers.

On AppleLink, you can find contact information on a company mentioned in this article by clicking the "Library Index" button in the lower-center of the Tech Info Library search window, then opening the "Third Party Company Directory" folder.

Copyright 1992, Apple Computer, Inc.

Keywords: KCOMPAT

=====

This information is from the Apple Technical Information Library.

19960215 11:05:19.00

Tech Info Library Article Number: 9743