



# Tech Info Library

## SuperDrive: Two Different Floppy Drive Carriers

Article Created: 30 November 1992

\* RESTRICTED: Apple Internal and Support Providers Only \*  
Not For General Public Release

TOPIC -----

The Apple FDHD SuperDrive uses two different floppy drive carriers.  
Which one is used with which systems?

DISCUSSION -----

The FDHD Service Module (P/N 661-0474), as it ships from Apple, consists of the actual FDHD drive with a drive carrier/shipping fixture bolted to the drive. This drive carrier/shipping fixture can be recognized by its Apple Service Part Number, which is 805-5050. It connects a SuperDrive to the following computers:

- Apple IIGS
- Macintosh SE and SE/30
- Macintosh Classic and Classic II
- Performa 200, 400, and 600
- Macintosh LC and LC II
- Macintosh IIvi and IIvx
- Macintosh II, IIx, IIfx
- Quadra 900 and 950.

The Macintosh IIcx, IIci, and Quadra 700 use a different SuperDrive drive carrier (Apple Service Part Number 805-0961).

When replacing a defective SuperDrive from a Macintosh IIcx, IIci, or Quadra 700 ONLY, the Service Provider must change drive carriers. Here's how:

- 1) Remove the defective SuperDrive from the system.
- 2) Remove the drive carrier (P/N 805-0961) from the defective SuperDrive and set them aside.
- 3) Unpack the replacement SuperDrive module (that you received from Apple Service and remove its drive carrier/shipping fixture (P/N 805-5050).

- 4) Attach the drive carrier (P/N 805-0961) from the system to the replacement SuperDrive.
- 5) Install the replacement SuperDrive module (with the IIcx/IIci/Quadra 700 drive carrier) into the system.
- 6) Attach the drive carrier/shipping fixture (P/N 805-5050) to the defective SuperDrive and return it to Apple Service.

With all other Apple computers that use the SuperDrive, simply install the SuperDrive Service Module as it comes from Apple Service.

The standard drive carrier/shipping fixture (P/N 805-5050) can be ordered from the Apple Service price pages if a Service Provider returns a SuperDrive to Apple Service and forgets to remove the IIcx/IIci/Quadra 700 drive carrier.  
Copyright 1992, Apple Computer, Inc.

Keywords: <None>

=====

This information is from the Apple Technical Information Library.

19960215 11:05:19.00

Tech Info Library Article Number: 11031