



Tech Info Library

System 7.5: Problem With Installer and Daystar Products (11/94)

Article Created: 09 November 1994

* RESTRICTED: Apple Internal and Support Providers Only *
Not For General Public Release

TOPIC -----

We are seeing cases where older Daystar accelerators are having problems with the System 7.5 Installer. Is there any additional information available on this problem?

DISCUSSION -----

DayStar Digital has provided the following information:

- 1) Connectix MODE 32 for 7.5 is required for users installing 7.5 on: Macintosh II, IIx, IIcx, and SE/30. It must be installed previous to installing System 7.5 or file corruption will occur.
- 2) DayStar strongly recommends a "clean install" of System 7.5 versus an Easy Install on top of an existing system.
- 3) Using version 4.0.1 of the ROMs and version 2.2 of QuadControl control panel will provide the best results.
- 4) Daystar is aware of the following problems:
 - Virtual memory does not work.
 - The QuadControl control panel crashes in 24 bit mode.
 - Maxima 3.0 and CloseView cause problems in some machines.

DayStar Engineering is working on a fix to these problems which may take the form of a new QuadControl, ROM or both. No further information is available at this time.

Support Information Services
Copyright 1994, Apple Computer, Inc.

Keywords: hts

=====

This information is from the Apple Technical Information Library.

19960215 11:05:19.00

Tech Info Library Article Number: 16708