



Tech Info Library

Apple 800K Drive Mechanism and Cable Compatibility

This article last reviewed: 6 January 1988

Drive and Cable Compatibility Chart

(YES = Compatible NO = Not Compatible)

	APPLE 3.5 MECHANISM Part # 661-0345 MFD-51W-03 red on silver label	800K DRIVE MECHANISM Part # 661-0305 MFD-51W or 51W-10 black on silver label
INTERNAL MACINTOSH	Yes- w/ yellow internal drive cable part # 590-0437	Yes- w/ red internal drive cable part # 590-0167
EXTERNAL 800 K DRIVE	YES	YES
UNIDISK 3.5 DRIVE	YES	YES
APPLE 3.5 DRIVE	YES	NO

NOTES:

1. If an Apple 3.5 Drive mechanism (P/N 661-0345) is installed as an internal Macintosh drive, it will require a YELLOW striped internal cable (P/N 590-0437) in order to operate.

2. If an older version of the Apple 800K Drive mechanism (P/N 661-0305) is installed as an internal Macintosh drive, it will require a RED striped internal flat cable (P/N 590-0167) in order to operate.

3. It is possible to install the recently released Apple 3.5 Drive mechanism in an external Macintosh 800K Drive or in a UniDisk 3.5 Drive. However, you should NEVER try to install the older verison 800K Drive mechanism in an Apple 3.5 Drive.

4. You can distinguish the Apple 3.5 Drive mechanism (P/N 661-0345) from the older version 800K Drive mechanism (P/N 661-0305) by its Apple and vendor part numbers. Also, each mechanism has a different colored drive label. Refer to the chart above for the details.

Copyright 1988 Apple Computer, Inc.

Keywords: hts

=====

This information is from the Apple Technical Information Library.

19960215 11:05:19.00

Tech Info Library Article Number: 1605